

**DEPARTMENT OF TRANSPORTATION****DIVISION OF ENGINEERING SERVICES**

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch  
690 Walnut Ave. St. 150  
Vallejo, CA 94592-1133  
(707) 649-5453  
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:** Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-002880**Date Inspected:** 10-Jun-2008**Project Name:** SAS Superstructure**OSM Arrival Time:** 1900**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 700**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai China

<b>CWI Name:</b>	N/A	<b>CWI Present:</b>	<b>Yes</b>	<b>No</b>
<b>Inspected CWI report:</b>	<b>Yes</b> <b>No</b> <b>N/A</b>	<b>Rod Oven in Use:</b>	<b>Yes</b>	<b>No</b> <b>N/A</b>
<b>Electrode to specification:</b>	<b>Yes</b> <b>No</b> <b>N/A</b>	<b>Weld Procedures Followed:</b>	<b>Yes</b>	<b>No</b> <b>N/A</b>
<b>Qualified Welders:</b>	<b>Yes</b> <b>No</b> <b>N/A</b>	<b>Verified Joint Fit-up:</b>	<b>Yes</b>	<b>No</b> <b>N/A</b>
<b>Approved Drawings:</b>	<b>Yes</b> <b>No</b> <b>N/A</b>	<b>Approved WPS:</b>	<b>Yes</b>	<b>No</b> <b>N/A</b>
		<b>Delayed / Cancelled:</b>	<b>Yes</b>	<b>No</b> <b>N/A</b>
<b>Bridge No:</b>	34-0006	<b>Component:</b>	Floor Beams, Skin plate, Deck Panel	

**Summary of Items Observed:**

Caltrans Quality Assurance Inspector Mr. David Kelsey (Caltrans QA Inspector) arrived at Shanghai Zhenhua Port Machinery Co (ZPMC) to observe the ZPMC Quality Control Inspectors noted below perform the duties and responsibilities as outlined in the Welding Quality Control Plan (WQCP), Contract Special Provisions and to randomly inspect the in-process welding fabrication at ZPMC fabrication facility for the Orthotropic Box Girder (OBG) and Tower bridge structural components.

CWI Inspector: NA No welding observed

Per ZPMC UT inspection notification (00508) this inspector performed Ultrasonic Testing (UT) verification of the QC UT Inspected and accepted welds. QA Inspector's visual and UT verification appears to be acceptable with AWS D1.5-02 section 6, table 6.3. Reference QA Ultrasonic Test Report TL-6027 dated 6/10/08 for specific test data.

Per ZPMC MT inspection notification (00510) this Inspector performed Magnetic Particle Testing (MT) verification of the QC MT Inspected and accepted welds. QA Inspector's MT verification appears to be acceptable with AWS D1.5-02 section 6.26.2.1 & 6.26.2.3 Reference QA Magnetic Particle Test Report TL-6028 dated 6-10-08 for specific test data.

The Caltrans QA Inspector Mr. David Kelsey performed Visual Testing (VT) on DP551-001 partial penetration welds 009 & 010, only partially completed and not recorded at this time. This inspector marked and measured visual indication such as under-fill, overlap, oversized, and incomplete fusion. Inspection and recording to be

---


## WELDING INSPECTION REPORT

( Continued Page 2 of 2 )

---

completed by subsequent shifts as required.

No other observation took place during the shift by this inspector.

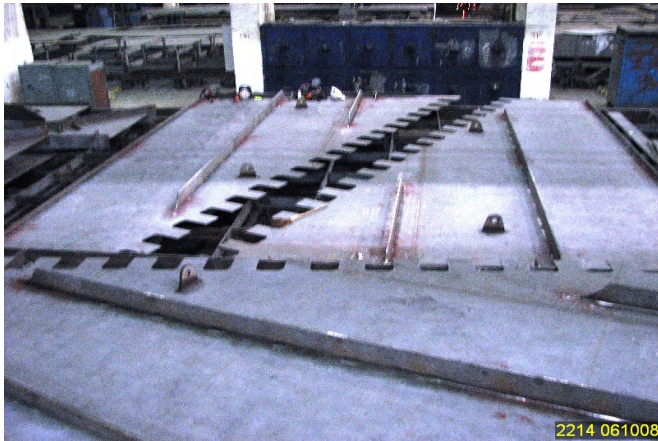

Item	Description	WBS	Dwg No.	Status
1	Above picture Various floor beam welds for MT			

### Summary of Conversations:

None noted.

### Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Mazen Wahbeh, (818) 292-0659, who represents the Office of Structural Materials for your project.

---

<b>Inspected By:</b>	Kelsey,David	Quality Assurance Inspector
<b>Reviewed By:</b>	Cochran,Jim	QA Reviewer

---